HPARTS LIST

SOFTEK®/AIRTEK® Front Suspension System for FCCC Motorhome Chassis


LIT NO: SP-183

DATE: March 2025 **REVISION**: H


CONTENTS

DESCRIPTION		DESCRIPTION	
■ SOFTEK with STEERTEK NXT Axle, 9K • 10K • 12K Vehicles built after March 2012	2	■ SOFTEK with STEERTEK Axle, 9K•10K Vehicles built prior to May 2010	6
■ SOFTEK with STEERTEK 1.5 Axle, 9K • 10K • 12K Vehicles built between May 2010 and March 2012.	4	■ AIRTEK with STEERTEK NXT Axle, 10K	8


SOFTEK with STEERTEK NXT Axle

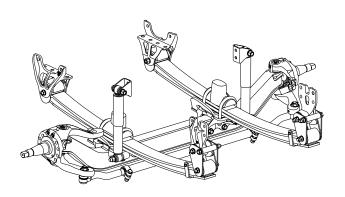


SOFTEK with STEERTEK Axle

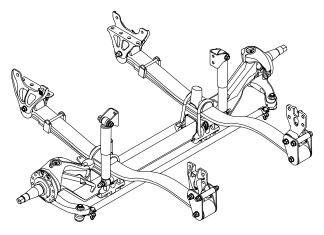

SOFTEK with STEERTEK 1.5 Axle

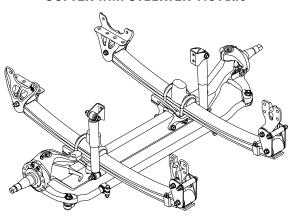


AIRTEK with STEERTEK NXT Axle

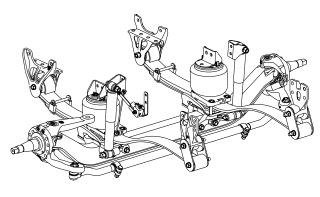



Vehicles built with STEERTEK NXT axle after March 2012

9K • 10K • 12K Capacity

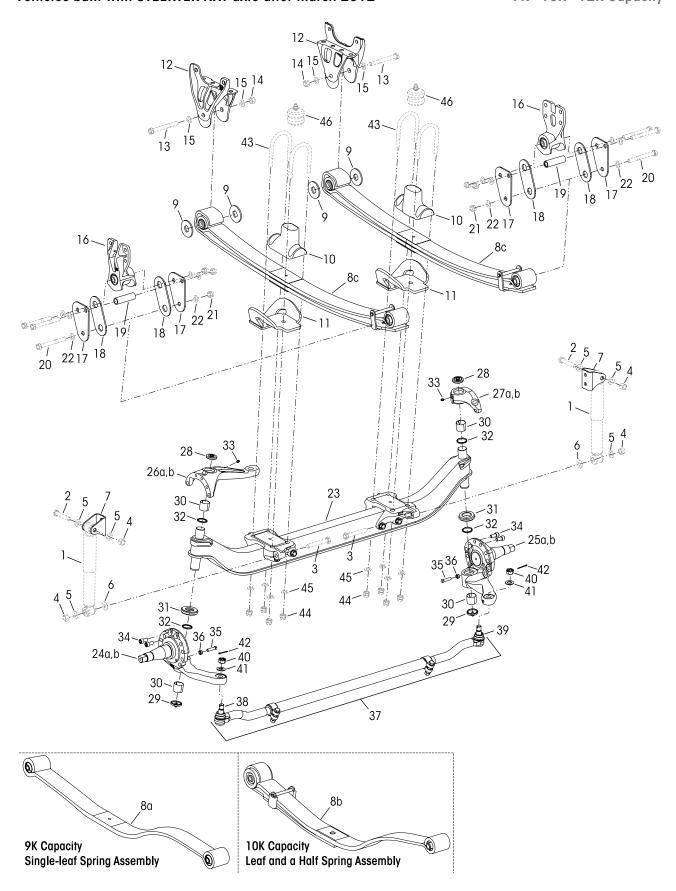



SOFTEK® with STEERTEK™ NXT Axle for FCCC Motorhome Chassis


KEY NO	. PART NO.	VEHICI DESCRIPTION QT		KEY NO	. PART NO.	VEN	HICLE QTY.
1		*Shock Absorber	2			Upper Steering Knuckle Assembly, Includes	
2		*3/4"-10 UNC x 4" Upper Shock Bolt	2			Key Nos. 28, 30, 32-33	
3		*3/4"-10 UNC x 5" Lower Shock Bolt	2	26		Left Hand	1
4		*3/4"-10 UNC Hex Locknut	4	а	60903-251	Equipped with Hydraulic Brakes	
5		*3/4" Hardened Washer	6	b	60903-453	Equipped with Air Brakes	
6		*Shock Spacer - 1/8" Thick	2	27		Right Hand	1
7	59423-002	Shock Bracket	2	а	60904-234	Equipped with Hydraulic Brakes	
8		Spring Assembly, Includes Spring Eye Bushings	2	b	60904-432	Equipped with Air Brakes	
а	66415-002	9K, Single-leaf		-	60961-630	Kingpin Bushing and Roller Thrust Bearing	
b	65710-002	10K, Leaf and a Half				Service Kit, One Side, Includes Key	
С	68115-001	12K, 2-Leaf				Nos. 28-34 & Loctite	
9	67493-000	Thrust Washer - Front Hanger	4	28	68687-003	Grease Cap Assembly, Upper	2
10	65714-000	Top Pad	2	29	68687-002	Grease Cap Assembly, Lower	2
11	68759-004	Sway Bar Bracket	2	30	58909-001	Kingpin Bushing	4
12	66297-000	Front Hanger	2	31	64256-000	Roller Thrust Bearing	2
13		*3/4"-10 UNC x 61/2" Bolt	2	32	68731-000	Kingpin Seal	4
14		*3/4"-10 UNC Locknut	2	33	33117-000	Grease Zerk	2
15		*3/4" Hardened Washer	4	34	60236-001	%"-11 UNC Socket Head Cap Screw	4
16	64316-000	Rear Shackle Bracket and Bushing Assembly	2	Not Shown	60937-000	Loctite® (Red) Compound Tube	1
17	66413-000	Rear Shackle Plate	4		60961-069	Stop Bolt Service Kit, One Side,	
18	64159-000	Rear Shackle Wear Pad	4			Includes Key Nos. 35-36	
19	60631-000	Shackle Stop Tube	2	35	60238-001	½"-13 UNC Square Head Bolt	2
20		*34"-10 UNC x 61/2" Hex Bolt	6	36	60240-000	½"-13 UNC Hex Jam Nut	2 2 1
21		*3/4"-10 UNC Hex Nylocknut	6	37	68869-001	Tie Rod Assembly, 9K•10K•12K	1
22			12			69 KPI, 5.36 Drop, 250 Ackermann	
		STEERTEK NXT Axle Assembly, 250 Ackermann	1			Includes Key Nos. 38-40	
	68927-004	Equipped with Hydraulic Brakes, Includes Key		38		**Left Hand Tie Rod End	1
		Nos. 23, 24a-27a, 31, 34, 37, 41-42		39		**Right Hand Tie Rod End	1
	68927-005	Equipped with Air Brakes, Includes Key		40		7/8" -14 UNF-2A Castle Nut	2
		Nos. 23, 24b-27b, 31, 34, 37, 41-42		41	22962-007	7/8" Flat Washer	2 2 2
23	68926-003M	Axle & Kingpin Assembly	1	42	17800-004	Tie Rod Nut Cotter Pin	
		Lower Steering Knuckle Assembly, 250 Ackerman	n	43		*¾"-16 UNF x 6½" U-bolt	4 8 8
		Includes Key Nos. 29-30, 32, 35-36		44		*¾"-16 UNF Hex Locknut	8
24		Left Hand	1	45		*¾" Hardened Washer	8
а	58900-267	Equipped with Hydraulic Brakes		46		*Auxiliary Spring	2
b	58900-469	Equipped with Air Brakes					
25		Right Hand	1				
α	58900-268	Equipped with Hydraulic Brakes					
b	58900-470	Equipped with Air Brakes					
u	JU70U-47U	Equipped willi All blukes					

NOTE: * Not supplied by Hendrickson, used for reference only. Hendrickson is not responsible for components supplied by the vehicle manufacturer. For assistance with maintenance and rebuild instructions on these components see vehicle manufacturer.

^{**} Item included in kit/assembly only, part not sold separately.



Vehicles built with STEERTEK 1.5 axle between May 2010 and March 2012 9K • 10K • 12K Capacity

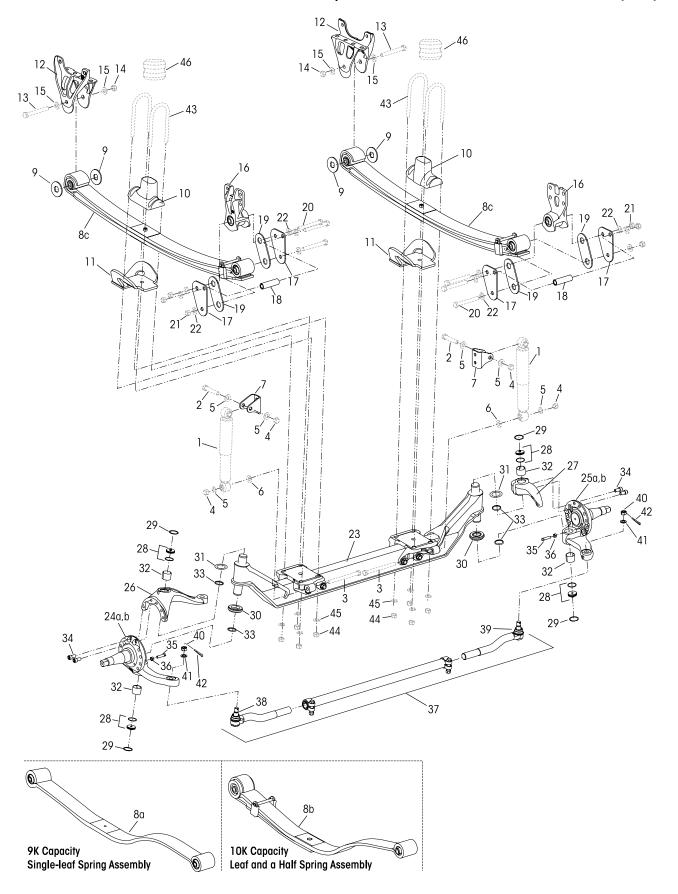



SOFTEK® with STEERTEK™ 1.5 Axle for FCCC Motorhome Chassis

KEY NO	. PART NO.	VEHIC DESCRIPTION Q	LE TY.	KEY NO	. PART NO.	VEHI DESCRIPTION (CLE QTY.
1		*Shock Absorber	2			Upper Steering Knuckle Assembly, Includes Key	_
2		*3/4"-10 UNC x 4" Upper Shock Bolt	2			Nos. 32-33	
3		*34"-10 UNC x 5" Lower Shock Bolt	2	26	60903-051	Left Hand	1
4		*34"-10 UNC Hex Locknut	4	27	60904-034	Right Hand	i
5		*34" Hardened Washer	6		60961-039	Kingpin Bushing and Roller Thrust Bearing	<u> </u>
6		* Shock Spacer - 1/8" Thick	2		00701 007	Service Kit, One Wheel End, Includes Key	
7	59423-002	Shock Bracket	2			Nos. 28-34 & Loctite	
8	07420 002	Spring Assembly, Includes Spring Eye Bushings	2	28	59156-000	Grease Cap Assembly	4
а	66415-002	9K, Single-leaf	_	29	58937-000	Retaining Ring	4
b	65710-002	10K, Leaf and a Half			60961-042	Roller Thrust Bearing Service Kit, One Wheel	
C	68115-001	12K, 2-Leaf			00701 042	End, Includes Key Nos. 31-34 & Loctite	
9	67493-000	Thrust Washer - Front Hanger	4	30	64256-000	Roller Thrust Bearing	2
10	65714-000	Top Pad	2	31	04200 000	Kingpin Shim As I	Req.
11	68759-003	Sway Bar Bracket	2	01	60259-001X	0.005" Thickness (Pack of 4)	voq.
12	66297-000	Front Hanger	2		60259-002	0.047" Thickness	
13	00277-000	*34"-10 UNC x 61/2" Bolt	2	32	58909-000	Kingpin Bushing	4
14		*34"-10 UNC Locknut	2	33	58910-001	Kingpin Seal	$\frac{-4}{4}$
15		*34" Hardened Washer	4	34	60236-001	5%"-11 UNC Socket Head Cap Screw	4
16	64316-000	Rear Shackle Bracket and Bushing Assembly	2		60937-000	Loctite (Red) Compound Tube	
17	66413-000	Rear Shackle Plate	4	- NOT SHOWIT	60961-069	Stop Bolt Service Kit, One Side,	
18	60631-000	Rear Shackle Stop Tube	2		00701 007	Includes Key Nos. 35-36	
19	64159-000	Rear Shackle Wear Pad	4	35	60238-001	½"-13 UNC Square Head Bolt	2
20	04107 000	*34"-10 UNC x 61/2" Hex Bolt	6	36	60240-000	½"-13 UNC Hex Jam Nut	2
21		*3/4"-10 UNC Hex Nylocknut	6	37	68869-001	Tie Rod Assembly, 9K•10K•12K	-
22			12	0,	00007 001	69 KPI, 5.36 Drop, 250 Ackermann	•
		STEERTEK 1.5 Axle Assembly, 250 Ackermann	1			Includes Key Nos. 38-40	
	66927-004	Equipped with Hydraulic Brakes, Includes Key	•	38		**Left Hand Tie Rod End	1
	00727 001	Nos. 23, 24a-25a, 26-31, 34-37, 41-42		39		**Right Hand Tie Rod End	i
		Replaces 66928-004		40		**7/8"-14 UNF-2A Castle Nut	
	66927-005	Equipped with Air Brakes, Includes Key		41	22962-007	7/8" Flat Washer	2
	00727 000	Nos. 23, 24b-25b, 26-31, 34-37, 41-42		42	17800-004	Tie Rod Nut Cotter Pin	2
		Replaces 66928-005,		43	17000 001	*3/4"-16 UNF x 61/2" U-bolt	<u>-</u>
23	66926-003M	Axle & Kingpin Assembly, Replaces 66926-002	1	44		*3/4"-16 UNF Hex Locknut	8
	00720 000	Lower Steering Knuckle Assembly, 250 Ackerman	n.	45		*3/4" Hardened Washer	8
		Includes Key Nos. 32-33	,	46		*Auxiliary Spring	
24		Left Hand	1			ramar, spinig	_
α .	58900-067	Equipped with Hydraulic Brakes					
b	58900-095	Equipped with Air Brakes					
25	-3,000,0	Right Hand	1				
a	58900-068	Equipped with Hydraulic Brakes	•				
b	58900-096	Equipped with Air Brakes					
		-4bbox 2-2000					


NOTE: * Not supplied by Hendrickson, used for reference only. Hendrickson is not responsible for components supplied by the vehicle manufacturer. For assistance with maintenance and rebuild instructions on these components see vehicle manufacturer.

^{**} Item included in kit/assembly only, part not sold separately.



Vehicles built with STEERTEK axle prior to May 2010

9K • 10K Capacity

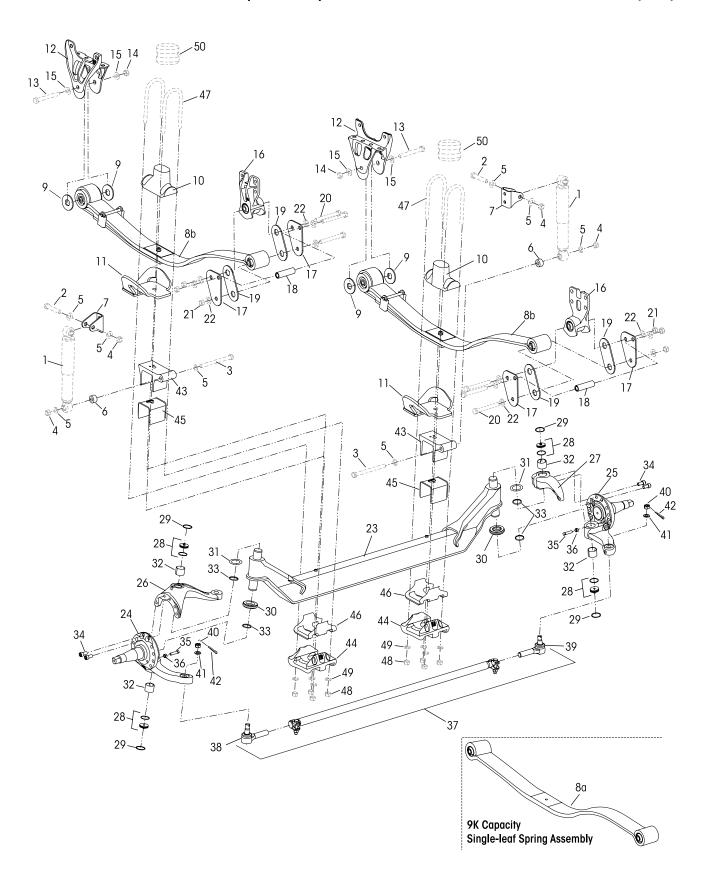




SOFTEK® with STEERTEK™ Axle for FCCC Motorhome Chassis

	*Shock Absorber	2
		-
	*¾"-10 UNC x 4" Upper Shock Bolt	8
	*3/4"-10 UNC x 5" Lower Shock Bolt	
	*¾"-10 UNC Hex Locknut	_
	*¾" Hardened Washer	_
59946-002	Shock Spacer	
59423-002		
66415-002		
65710-002		
67493-000		
65925-000		_
	Front Hanger, Replaces 65711-000	_
00277 000	*3//"-10 IINC x 61/2" Bolt	
		_
		_
64316-000		_
		_
00410 000		
	•	
40431-000		
04107-000		
		1
70052-888		_
70702-7777		
4400E 004).
04900-004		
	•	
E0000 043		
30900-003		
E0000 0/7		
58900-001		
E0000 074		
38900-064		
50000 070		
60903-051		
(000 / 00 /		
60904-034	Includes Key Nos. 32-33	
60961-039	Kingpin Bushing w/Roller Thrust Bearing	
	Service Kit, One Wheel End,	
	59423-002 66415-002 65710-002 67493-000 65925-000 68759-003 66297-000 64316-000 6413-000 64159-000 70952-XXX 64905-004 58900-063 58900-067 58900-064 58900-064 58900-068 58900-002 60903-051	Sp423-002 Shock Bracket Spring Assembly, Includes Spring Eye Bushings 66415-002 10K, Replaces 65710-001 10K, Replaces 65710-001 10K, Replaces 65899-000 10K, Replaces 65899-000 10K Sway Bar Bracket, Replaces 66233-001 10K Sway Bar Bracket and Bushing Assembly 10K Sway Bar Bracket and Bushing Bracket 10K Sway Bar Bracket and Bushing Bracket 10K Sway Bar Bar Bar Bar

KEY NO	. PART NO.	VEH DESCRIPTION	ICLE QTY.
28	59156-000	Grease Cap Assembly	4
29	58937-000	Retaining Ring	4
	60961-042	Roller Thrust Bearing Service Kit, One Wheel End, Includes Key Nos. 31-34 and Loctite	
30	64256-000	Roller Thrust Bearing	2
31		Kingpin Shim As	Req.
	60259-001X	0.005" Thickness (Pack of 4)	
	60259-002	0.047" Thickness	
32	58909-000	Kingpin Bushing	4
33	58910-001	Kingpin Seal, Replaces 58910-000	4
34	60236-001	%"-11 UNC Socket Head Cap Screw	4 2
Not Shown	60937-000	Loctite (Red) Compound Tube	2
	60961-069	Stop Bolt Service Kit, One Side,	
		Includes Key Nos. 35-36	
35	60238-001	½"-13 UNC Square Head Bolt	2
36	60240-000	½"-13 UNC Hex Jam Nut	$\frac{2}{2}$
37	60239-007	*****Tie Rod Assembly, Includes Key Nos. 38-40	0 1
38		Replaces 64801-006	
39		**Left HandTie Rod End	1
39 40		**Right Hand Tie Rod End **7/8" Castle Nut	
40	22962-007		$\frac{2}{2}$
41		7/8" Flat Washer Tie Rod Nut Cotter Pin	
42	17800-004 59952-024	Top Axle Wrap	
43	39932-024	****Bottom Axle Wrap	$\frac{2}{2}$
45	60508-000	Top Axle Wrap Liner	$\frac{2}{2}$
46	59845-000	Bottom Axle Wrap Liner	$\frac{2}{2}$
47	39043-000	*3/4"-16 UNF x 10" U-bolt	$\frac{2}{1}$
47		*34"-16 UNF Hex Locknut	2 2 2 2 2 2 2 2 4 8
49		*34" Hardened Washer	8
50		*Auxiliary Spring	<u>o</u>
50		Auxiliary Spring	2

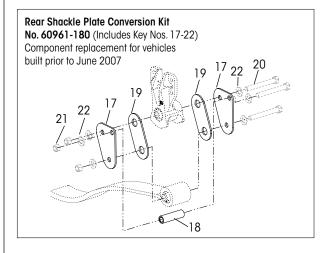


NOTE: * Not supplied by Hendrickson, used for reference only. Hendrickson is not responsible for components supplied by the vehicle manufacturer. For assistance with maintenance and rebuild instructions on these components see vehicle manufacturer.

- ** Item included in kit/assembly only, part not sold separately.
- *** No longer available. See Rear Shackle Plate Conversion Kit No. 60961-180.
- **** No longer available, contact Hendrickson for replacement.
- ***** The tie rod assembly is designed for use on a suspension system with hydraulic brakes, it is not designed for vehicles equipped with air brakes.



Vehicles built with STEERTEK NXT axle

10K Capacity

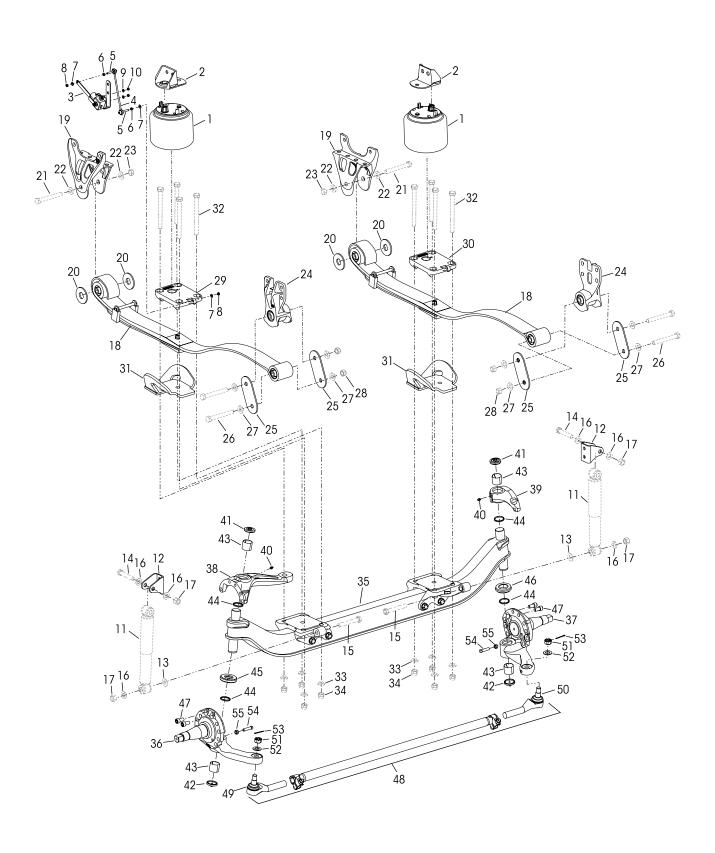



AIRTEK® with STEERTEK™ NXT Axle for FCCC Motorhome Chassis

ket † & Linkage Assembly, Nos. 3-10	2 2 1 36 37	58900-469 58900-470	Left Hand Right Hand	_
t & Linkage Assembly,	<u>2</u> 37	58900-470	Right Hand	- 1
	1		•	1
1 NO 3 . U - 1 U			Upper Steering Knuckle Assembly, Includes Key Nos. 40-41, 43-44	
Valve	1 38	60903-436	Left Hand	1
bly	1 39	60904-432	Right Hand	1
ıd		60961-628	Kingpin Bushing and Bearing Service Kit,	
Nut	3		Axle Set, Includes Kit Nos. 60961-629 & -63	0
r	3	60961-629	Left Hand Kingpin Bushing with Composite	
Nut	2		Thrust Bearing, Service Kit,	
	2		Includes Key Nos. 40-45, 47, Loctite	
knut	2	60961-630	Right Hand Kingpin Bushing with Roller Thrus	st t
er	2		Bearing Service Kit,	
	2		Includes Key Nos. 40-44, 46-47 & Loctite	
- ½"Thick	2 40	33117-000	Grease Zerk	2
1" Upper Shock Bolt	2 41	68687-003	Grease Cap Assembly, Upper	2
5" Lower Shock Bolt	2 42	68687-002	Grease Cap Assembly, Lower	2
r	6 43	58909-001	Kingpin Bushing	4
ex Locknut	4	60961-631	Thrust Bearing Service Kit, Axle Set,	
embly	2		Includes Kit Nos. 60961-632 & -633	
		60961-632	Left Hand Composite Thrust Bearing Service	Kit,
- Front Hanger	4		Includes Key Nos. 44-45, 47 & Loctite	
½" Hex Bolt	2	60961-633	Right Hand Roller Thrust Bearing Service Kit,	
r	4		Includes Key Nos. 44, 46-47 & Loctite	
Locknut	2 44	68731-000	Kingpin Seal	4
racket and Bushing Assembly	2 45	59828-000		1
late		64256-000		1
5½" Hex Bolt		60236-001	5%"-11 UNC Socket Head Cap Screw	4
	8 Not Sho	wn 60937-000	Loctite® (Red) Compound Tube	1
ex Locknut	4 48	68869-001		1
ad			**%" 7/8" -14 UNF-2A Castle Nut	2
Pad			**Left Hand Tie Rod End	1
et			**Right Hand Tie Rod End	1
½" Hex Bolt	8 52		%" Flat Washer	2
r		17800-004	Tie Rod Nut Cotter Pin	2
Locknut	8	60961-069	Stop Bolt Service Kit, One Side,	
Axle Assembly, 69" KPI,	1		Includes Key Nos. 54-55	
EO Askarmann Instudes Var				2
	1 54	60238-001	1/2"-13 UNC Square Head Bolt	
5-48, 52-53 Assembly	1 <u>54</u> <u>55</u>	60238-001 60240-000	13 UNC Square Head Bolt 2"-13 UNC Hex Jam Nut	2
rijo	Front Hanger 1/2" Hex Bolt r Locknut acket and Bushing Assembly ate 1/2" Hex Bolt x Locknut ad Pad et 1/2" Hex Bolt r Locknut ad Prod et 1/2" Hex Bolt r Locknut Axle Assembly, 69" KPI,	### Part	Sembly 2	Includes Kit Nos. 60961-632 & -633

NOTE: * Not supplied by Hendrickson, used for reference only. Hendrickson is not responsible for components supplied by the vehicle manufacturer. For assistance with maintenance and rebuild instructions on these components see vehicle manufacturer.

^{**} Item included in kit/assembly only, part not sold separately.

This is a general parts list to provide directional information. Components may vary by model. Questions in regards to parts, contact Hendrickson Truck Parts at 1.866.755.5968 (Toll-free U.S. and Canada), 630.910.2800 (Outside U.S. and Canada) or email: truckparts@hendrickson-intl.com during normal business hours.

Actual product performance may vary depending upon vehicle configuration, operation, service and other factors.

All applications must comply with applicable Hendrickson specifications and must be approved by the respective vehicle manufacturer with the vehicle in its original, as-built configuration.

Contact Hendrickson for additional details regarding specifications, applications, capacities, and operation, service and maintenance instructions.

Call Hendrickson at 1.866.755.5968 (toll-free) or 1.630.910.2800 for additional information.



www.hendrickson-intl.com

TRUCK COMMERCIAL VEHICLE SYSTEMS

800 South Frontage Road Woodridge, IL 60517-4904 USA 1.866.755.5968 (Toll-free U.S. and Canada) 1.630.910.2800 (Outside U.S. and Canada) Fax 1.630.910.2899

© 2005 – 2025 Hendrickson USA, L.L.C. All Rights Reserved. All trademarks shown are owned by Hendrickson USA, L.L.C., or one of the affiliates, in one or more countries. Information contained in this literature was accurate at the time of publication. Product changes may have been made after the copyright date that are not reflected.