EPARTS LIST


HS190T / HS230 / HS300T


LIT NO: L1085


DATE: January 2022 **REVISION**: B






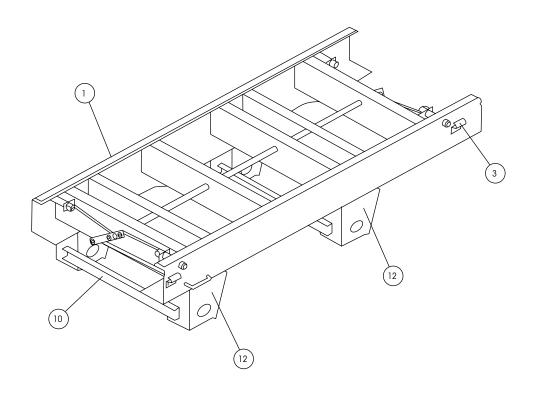

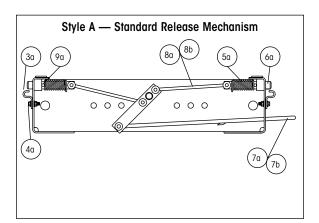

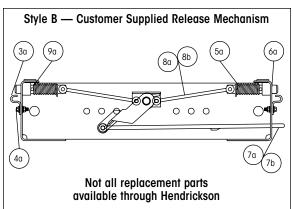

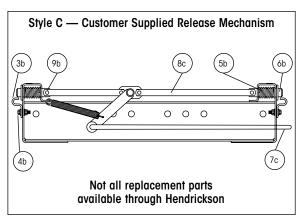

2 L1085 Rev B




HS190T / HS230 / HS300T SLIDER BOX COMPONENTS

ITEM	DESCRIPTION	PART NO.	SYSTEM QTY.	NOTE
1	SLIDER WEAR PAD KIT			
	1a 49" axle centers	S-14342-1	2	Includes (1) wear pad and (8) screws
2	WEAR PAD SCREW (not shown)	A-29372	16	
3	BODY RAIL CLIP			
	3a Style A and Style B	S-14108	4	Hole centers measure 1-1/2"
	3b Style A and Style B	S-22366	4	Hole centers measure 2"
	3c Style C	9635-00		Hole centers measure 4"; includes
	•			rail clip bolt. Contact Hendrickson
				for assistance
4	BODY RAIL CLIP BOLT			
5	4a Style A and Style B	SA-6900-2	8	$\frac{1}{2}$ "-13 × 1- $\frac{1}{2}$ " flanged bolt, grade 8
	4b Style C	N/A		Included in part # 9635-00
	LOCKING PIN SPRING			
	5a Style A and Style B	S-14102	4	
	5b Style C	12779-01		Contact Hendrickson for assistance
6	LOCKING PIN			
	6a Style A and Style B	S-14104	4	
	6b Style C	12716-01		Contact Hendrickson for assistance
7	ACTUATOR ARM			
	7a Style A — 42" box width	S-26010-2	1	
	Style B — 42" box width	B-14573-2	1	
	7b Style A — 48" box width	S-26010-1	1	
	Style B — 48" box width	B-14573-2	1	
	7c Style C — 42" and 48" box widths	12781-01		Contact Hendrickson for assistance
8	LOCKING PIN LINK			
	8a Style A — 42" box width	B-14112-2	4	
	Style B — 42" box width	B-14112-4	4	
	8b Style A — 48" box width	B-14112-1	4	
	Style B — 48" box width	B-14112-3	4	
	8c Style C — 42" box width	11412-02		Contact Hendrickson for assistance
	Style C — 48" box width	11412-16		Confider Herianickson for assistance
9	LOCKING PIN ROD			
	9a Style A and Style B	S-14106	4	
	9b Style C	12780-1		Contact Hendrickson for assistance
10	FRAME BRACKET CHANNEL	A-1631-6	2	For units with welded alignment only
11	BEAM ASSEMBLY (see back page)			
	11a Front or Rear; overall length is 32.65"			
	Roadside	S-20000-1		Bushing included
	Curbside	S-20000-2		Bushing included
	11b Rear; overall length is 36.82"			
	Roadside	S-21736-1		For units equipped with SURELOK®.
	Curhoido	0.0170/0		Bushing included For units aguinged with SURFLOK
	Curbside	S-21736-2		For units equipped with SURELOK Bushing included
	11c Front or Rear; overall length is 34.57"			bushing included
	Roadside	S-20186-1		HS300T only
	Curbside	S-20186-2		HS300T only
12	FRAME BRACKET (see back page)	J-20100-Z		Contact Hendrickson for assistance
13	AIR SPRING (see back page)			Common memorition assistance
	13a HS190T Sliders	S-20223	4	
	13b HS230 Sliders	S-20223	4	
	13c HS300T Sliders	S-4771	4	
14	AIR SPRING BOLT KIT (see back page)	J-47 / I	4	
	14a HS190T and HS230	S-20033/2	Л	
-	146 HS300T	S-20033/2 S-4903	2	
15		J-47UJ		
10	ALIGNMENT COLLARS (see back page)	S-2770	0	
	15a Welded alignment		8	Divot holt halo is affect from contain
	15b Eccentric (outer) QUIK-ALIGN®	S-20925	4	Pivot bolt hole is offset from center of collar
	15c Concentric (inner) QUIK-ALIGN	S-20924	4	Pivot bolt hole is in center of collar
	I DE CONCENNIC (INNEL) QUIN-ALION	J-ZU9Z4	4	i ivoi poli nole is ili centel di colidi

L1085 Rev B



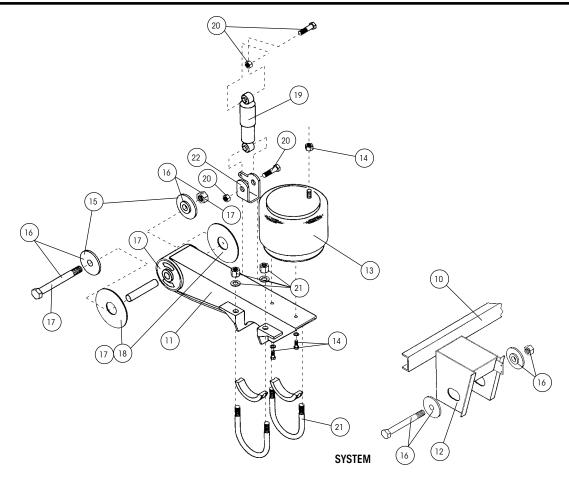

ITEM	DESCRIPTION	PART NO.	QTY.	NOTE
16	PIVOT BOLT KIT			
	16a Welded alignment	S-3646	4	Includes bolt, nut and delrin liner
	16b QUIK-ALIGN ¹	S-24679	4	Includes bolt, HEXNUT and washers
17	TRI-FUNCTIONAL® BUSHING KIT ²			
	17a Welded alignment	S-6914	4	
	17b QUIK-ALIGN	S-24691	4	
18	BUSHING TUBE SPACERS	S-21099	8	
19	SHOCK ABSORBER			
	19a HS190T Sliders	S-20001	4	
	19b HS230 Sliders	S-20002	4	
	19c HS300T Sliders	S-20126	4	
20	SHOCK ABSORBER BOLT KIT	S-20031/2	4	
21	U-BOLT KIT	S-21140	2	
22	LOWER SHOCK CLEVIS	S-20069	4	

- 1. Best installed with Hendrickson's E-20 socket S-24536 (1-inch drive sleeveless), S-25119 (1-inch drive sleeve) or S-24303 (3/4-inch drive sleeveless).
- 2. Bushing tool S-21307 is required to correctly re-bush the suspension.

Actual product performance may vary depending upon vehicle configuration, operation, service and other factors.

All applications must comply with applicable Hendrickson specifications and must be approved by the respective vehicle manufacturer with the vehicle in its original, as-built configuration.

Contact Hendrickson for additional details regarding specifications, applications, capacities, and operation, service and maintenance instructions.

Call Hendrickson at 330.489.0045 or 866.RIDEAIR (743.3247) for additional information.

HHENDRICKSON

www.hendrickson-intl.com

TRAILER COMMERCIAL VEHICLE SYSTEMS

2070 Industrial Place SE Canton, OH 44707-2641 USA 866.RIDEAIR (743.3247) 330.489.0045 • Fax 800.696.4416 Hendrickson Canada ULC

2825 Argentia Road, Unit #2 - 4 Mississauga, ON Canada L5N 8G6 800.668.5360 905.789.1030 • Fax 905.802.9423 Hendrickson Mexicana

Circuito El Marqués Sur #29 Parque Industrial El Marqués Pob. El Colorado, Municipio El Marqués, Querétaro, México C.P. 76246 +52 (442) 296.3600 • Fax +52 (442) 296.3601